

Date: Monday, 6/12/2006 3:22:36 PM
 User: Kim Johnston

Process Sheet

Customer :	CU-DAR001 Dart Helicopters Services	Drawing Name :	SKID TUBE ASSEMBLY
Job Number :	27483A		
Estimate Number :	10023		
P.O. Number :	N/A	Part Number :	D205634041
This Issue :	6/12/2006	S.O. No. :	N/A
Prsht Rev. :	NC	Drawing Number :	D2580 REV C
First Issue :	N/A	Project Number :	N/A
Previous Run :	27482A	Drawing Revision :	C
	Type :	Material :	N/A
	LANDING GEAR	Due Date :	7/5/2006
Written By :	<i>SEE COMMENT Below</i>		Qty: 1 Um: Each
Checked & Approved By :	<i>06.06.13</i>		
Comment :	Est Rev: N 02.08.28 FP was QC5 in Step 27; Added QC5 to Step 30 KJ Est Rev. O 06.02.28 Added paperwork EC		

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

1.0	D25001190	Ext'n -1' Beam Tube 4"
-----	-----------	------------------------



Comment: Qty.: 1.0400 Each(s)/Unit Total : 1.0400 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	D2500-1-190	Skid Tube Extrusion	<i>B2469</i>

Pm' 06-06-22

2.0	DC	DOCUMENT CONTROL
-----	----	------------------



Comment: DOCUMENT CONTROL

Photocopy D205-634 bluefile & type labels per PPP D205-634 CHG001

KS 06 06-26

3.0	D2596	205 Web
-----	-------	---------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	D2596	205 Web	<i>B27655</i>

Pm' 06-06-27

4.0	LANDING GEAR 1	LANDING GEAR RESOURCE 1
-----	----------------	-------------------------



Comment: LANDING GEAR RESOURCE 1

1- Inspect mat'l D2500-1-190 for damage *Pm' 06-06-22*

2-Cut D2500-1-190 per Dwg D2580 if necessary Deburr ends *Pm' 06-06-22*

3-Drill pilot holes using drill jig DT 8149 *Pm' 06-06-22*

4-Acid etch and Alodine tube per QSI 005 4.1 *Pm' 06-06-22*

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Mfg / Design Mgr	Approval QC Inspector

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Design Mgr	Approval QC Inspector
			Initial Design Mgr	Action Description Design Mgr		Sign & Date			

Part No: _____ PAR #: _____ Fault Category: _____

NOTE: Date & initial all entries

NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

Date: Monday, 6/12/2006 3:22:37 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 27483A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

5-Open holes to 0.500" as per Dwg D2580 without cutting fluid

Pm 06-06-270

6-Countersink holes as per Dwg D2580 without cutting fluid

Pm 06-06-270

7-Deburr and blow out all chips from inside of tube

Pm 06-06-270

8-Bond web in place per QSI 015. Allow 12 Hrs. cure time before cutting

Pick:

Qty Part Number Description Batch

A/R Sikaflex-291 *m101126*

Sikaflex expire date: *06-11-01*

Start Time: *2:30*

Fin Time: *6-6-28*

Pm 06-06-270

5.0

BENDING

BENDING MACHINE



Comment: BENDING MACHINE

1-Bend as per program D2580.C on CNC Bender and Folio FT009.

DP 06-6-28

2-Cut tubes as per Dwg. D2580

6.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Deburr ends after cutting. Remove alodine from around holes

Pm 06-06-300

7.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

Job 06-300

8.0

D25763

Step (Machining Detail)



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2576-3

Step

B-23060

BE

06-07-05

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Mfg / Design Mgr	Approval QC Inspector

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action			Verification Section C	Approval Design Mgr	Approval QC Inspector
			Initial Design Mgr	Action Description Design Mgr	Sign & Date			

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

NOTE: Date & initial all entries

QA: N/C Closed: _____ Date: _____

Date: Monday, 6/12/2006 3:22:37 PM
User: Kim Johnston

Process Sheet

 
Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 27483A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

9.0

D2579

Crossbolt Spacer



Comment: Qty.: 20.0000 Each(s)/Unit Total: 20.0000 Each(s)

Pick:

Qty

Part Number

Description

Batch

20

D2579

Spacers

B25977 BE 06-07-05

10.0

LARGE FAB 1

LARGE FABRICATION RESOURCE 1



Comment: LARGE FABRICATION RESOURCE 1

1-Prepare tube for welding D2576-3 StepRemove alodine as required.

BE 06-07-05

2-Weld step D2576 as per Dwg. D2580 and QSI 004

A/R

Aluminum Rod

M100660

BE 06-07-05

3-Weld crossbolt spacers D2579 as per Dwg. D2580 and QSI 004. For D2579

spacers, weld one

side, pass 3/8" drill, weld other side, pass 3/8" drill

A/R

Aluminum Rod

M100660

BE 06-07-05

4-Grind welds as per Dwg D2580 Grind flush ridge made from bending

DM 06-07-12

5-Drill holes for wearplates using DT 8217Open holes to 19/64", adjust stopper not to hit web. Deburr

DM 06-07-12

6-Counterbore crossbolt spacers to 7/16" ID x 1.0" deep as per Dwg D2580. Deburr holes

7-Drill pilot holes for aft cap using DT 8215Open holes to #6 Drill bit. Deburr

8-Drill pilot holes for Tow ring using DT8091, open to .640"and Deburr

DP 6-7-13

11.0

QC5/9

WELD INSPECTION



Comment: WELD INSPECTION

Inspect weld and Counterbore work to Step 20

DM 06-07-14

12.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Powder Coat White (Ref: 4.3.5.2) as per QSI 005 4.3

DM 06-07-26

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Mfg / Design Mgr	Approval QC Inspector

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action			Verification Section C	Approval Design Mgr	Approval QC Inspector
			Initial Design Mgr	Action Description Design Mgr	Sign & Date			

Part No: _____ PAR #: _____ Fault Category: _____

NOTE: Date & initial all entries

NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

Date: Monday, 6/12/2006 3:22:37 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 27483A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

13.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



(1)

Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

14.0

D25771

Wearplate Fwd



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	D2577-1	Wearplate	

B25137
B26350

15.0

D25773

Wearplate Aft



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	D2577-3	Wearplate	

B26058

16.0

D25775

Wearplate, Centre



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	D2577-5	Wearplate	

B24199

17.0

ALS71032130

Insert



Comment: Qty.: 44.0000 Each(s)/Unit Total : 44.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
44	ALS7-1032-130	Washer	

m19393

Insert

18.0

AN960JD10L

Washer



Comment: Qty.: 44.0000 Each(s)/Unit Total : 44.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
44	AN960JD10L	Washer	

m101291

a.m 06-27-06

(1)

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Mfg / Design Mgr	Approval QC Inspector

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Design Mgr	Approval QC Inspector
			Initial Design Mgr	Action Description Design Mgr		Sign & Date			

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

NOTE: Date & initial all entries

QA: N/C Closed: _____ Date: _____

Date: Monday, 6/12/2006 3:22:37 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 27483A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

19.0

AN34A

Bolt



Comment: Qty.: 44.0000 Each(s)/Unit Total : 44.0000 Each(s)

Pick:

Qty Part Number Description Batch
44 AN3-4A Bolt ~~Bolt~~ DL M18310
g

20.0

D25941

Plug



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)

Pick:

Qty Part Number Description Batch
16 D2594-~~3~~ ~~O-RING~~ B27168 DL
g plug B25593

21.0

D25943

O-Ring



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)

Pick:

Qty Part Number Description Batch
16 D2594-3 ~~plug~~ DL B27168
g orings B25593

22.0

D2855

Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Cap

Batch: B26351

23.0

AN35A

Bolt



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Bolt

Batch: M15205

24.0

AN960JD10L

Washer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Washer

Batch: M100291

a.m. 06-07-27 *g*

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Mfg / Design Mgr	Approval QC Inspector

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Design Mgr	Approval QC Inspector
			Initial Design Mgr	Action Description Design Mgr		Sign & Date			

Part No: _____ PAR #: _____ Fault Category: _____

NOTE: Date & initial all entries

NCR: Yes ☒ No ☐ DQA:  Date: 06/08/02

QA: N/C Closed: _____ Date: _____

Date: Monday, 6/12/2006 3:22:37 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 27483A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

25.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Install inserts & wearplates as per Dwg. D2580. Use a drop of Sikaflex on insert holes before installing wearplates

A/R Sikaflex-291 M101621

Sikaflex expire date: 02-07

2-Coat D2594-3 O' rings with Petroleum Jelly and install on D2594-1 plugs as per Dwg D2580

3-Inspect for foreign object per QSI 024

4-Install 2855 Aft Cap as per Dwg D2580 and seal Fwd Step & Aft Cap with Sikaflex. Clean excess adhesive

A/R Sikaflex-291 M101621

Sikaflex expire date: 02-07

A-R 06-07-27 (1)

5-Wing Walk as per Dwg D2580 and QSI 005 4.4

M101621

FC 06 07 31 (1)

26.0

QC5

INSPECT WORK TO CURRENT STEP



DC 06/07/31



(1)

Comment: Inspect Aft Cap, Fwd Step and Wing Walk of work to Current Step Inspect for Foreign objects per QSI 024

27.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D205-634-041

Location: _____

PPP Rev: _____

M/R

28.0

DC

DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Inspection Level 21

06/08/02 (1)

Job Completion



C 206108102

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Mfg / Design Mgr	Approval QC Inspector

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action			Verification Section C	Approval Design Mgr	Approval QC Inspector
			Initial Design Mgr	Action Description Design Mgr	Sign & Date			

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

NOTE: Date & initial all entries

QA: N/C Closed: _____ Date: _____



RELEASED
98/09/17 DS

DESIGN <i>[Signature]</i>	DRAWN BY <i>[Signature]</i>	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED <i>[Signature]</i>	APPROVED <i>[Signature]</i>	DRAWING NO. D2580	REV. C SHEET 1 OF 2
DATE 98.08.26		TITLE 205 SKIDTUBE ASSEMBLY	SCALE NTS
A	96.09.16	NEW ISSUE	
B	96.12.02	AS MANUFACTURED	
C	98.08.26	REDRAWN, INCLUDED DEO 9094/9097	

QTY	Part Number	Description
X	D2580-041	SKIDTUBE ASSEMBLY
*	D2500-1	EXTRUSION
1	D2596	205 WEB
1	D2575	AFT CAP
1	D2576 - 3	STEP
20	D2579	CROSS BOLT SPACER
16	D2594-1	PLUG
16	D2594-3	O-RING
1	D2577-1	WEARSHOE
1	D2577-3	WEARSHOE
1	D2577-5	WEARSHOE
44	ALS7-1032-130 or AKS7-1032-130 or AKS4-1032-130 or ALS4-1032-130	INSERT
46	AN3-4A	BOLT
46	AN960JD10L	WASHER


00.08.28
UP 00.08.28

EFFECTIVE	DEOS
98/12/14	98/03/28
DEO 9124	DED 9183

GENERAL NOTES:

- 1) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 2) LENGTH OF D2500-1 EXTRUSION BEFORE BENDING = 190 INCHES *
- 3) INSERT D2596 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP.
- 4) BEND AS A SMOOTH RADIUS STARTING WITH A MAXIMUM CENTERLINE RADIUS OF 60 AND ENDING WITH A MINIMUM RADIUS OF 30. A MAXIMUM REDUCTION OF 0.200 IN DIAMETER IS ALLOWABLE IN THE BENT PORTION OF THE TUBE.
- 5) USE DART DRILL TEMPLATE TD2577-205 TO LOCATE AND DRILL Ø0.297 HOLES FOR WEARSHOE INSERTS. INSTALL ALS7-1032-130 PER SECTION D-D (44 PLACES) AFTER FINISH. INSTALL AN3-4A BOLTS AND AN960JD10L WASHERS WITH SIKAFLEX-241.
- 6) WELDING TO BE DONE PER DART QSI 004.
- 7) FINISH:
ACID ETCH, ALODINE PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB
POWDER COAT ASSEMBLY GLOSS WHITE (REF 4.3.5.1) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4
- 8) INSERT D2594-1 PLUG C/W D2594-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE) AFTER FINISH (16 PLACES).

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE

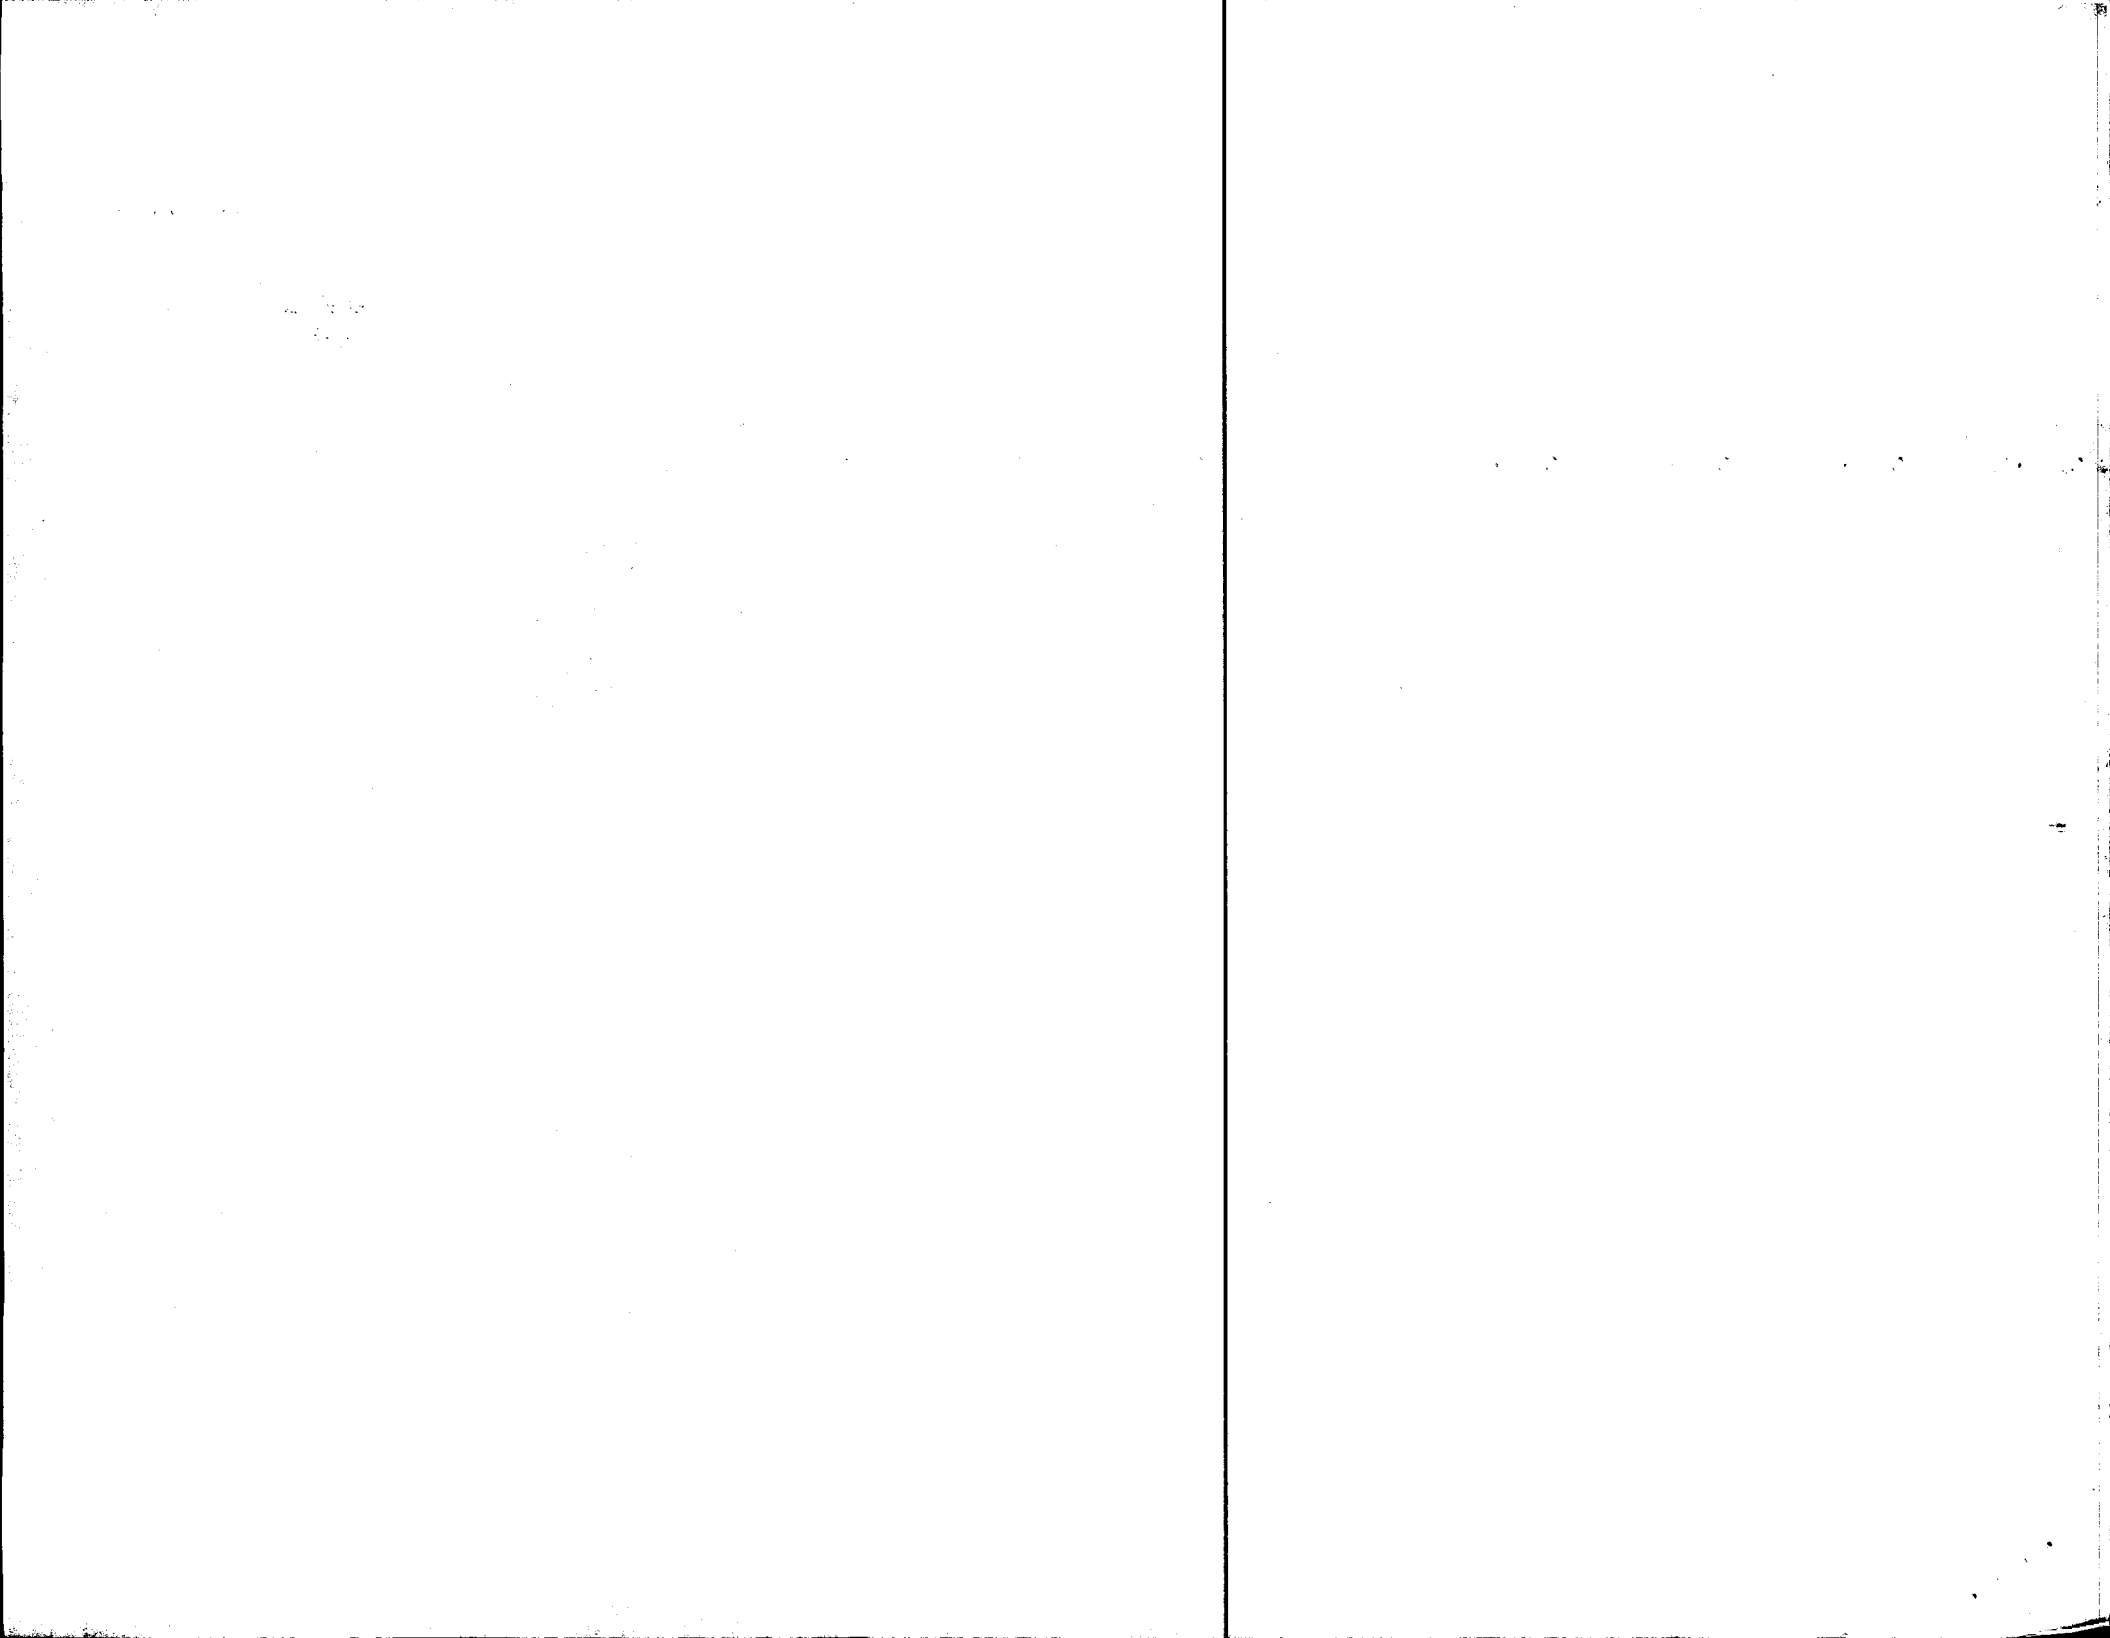

A technical diagram showing a cross-section of a bolt and a cap. The bolt is labeled with 'AN3-4A BOLT (1)' and 'AN960JD10L WASHER (1) (2 PLACES)'. The cap is labeled 'D2575 CAP'. A dimension line indicates a distance of '0.40' from the bolt head to the cap. A note at the top left says 'DRILL PRIOR TO D2575 CAP INSTALLATION (2 PLACES)'. A note at the top right says 'SEAL WITH SIKAFLEX-241'. The diagram shows the cap being installed over the bolt head, with a dashed line indicating the seal area.

D2579 SPACER

WEB (REF)

3 SPACERS

4 PLACES

AFTER PERFORM

1. CHA
2. INS
3. WEL
4. C'B

AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR #0.508 HOLES ONLY:

1. CHAMFER HOLE 0.050 X 45°
2. INSERT D2579 SPACER (20 PLACES)
3. WELD INTO PLACE AND GRIND FLUSH
4. C'BORE D2579 SPACER TO #0.437 X 1.00 DEEP

[illegible]

The diagram illustrates a road cross-section with two circular curves. The left curve has a radius of 13.4 and a central angle of 4°. The right curve has a radius of 32.0 and a central angle of 4°. The distance between the hole and the tangent point is 1.0 for both curves. The total width of the road is 11.0. The distance between the two holes is 20.0. The distance from the centerline to the edge of the road is 1.4.

[illegible]

RELEASE
98/09/17 DS

DESIGN <i>[Signature]</i>	DRAWN BY <i>[Signature]</i>	 DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	REV. C
CHECKED <i>[Signature]</i>	APPROVED <i>[Signature]</i>		DRAWING NO. D2580
DATE 98.08.26		TITLE 205 SKIDTUBE ASSEMBLY	SCALE 1:24

UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 274837A

